



Status



2M & 3M WIDE




CASTILLO CARBON

PR: 100W X 100L
PTS: 20W X 20L



CASTILLO NAVY

PR: 100W X 100L
PTS: 20W X 20L

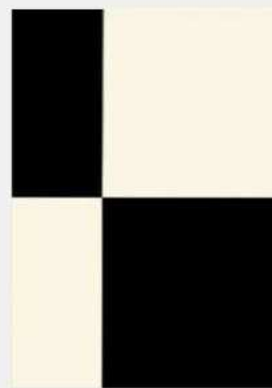

ECHIQUEUR II BLACK WHITE

PR: 100W X 100L
PTS: 25W X 25L



GRANIT ALU BLACK

PR: 100W X 100L
PTS: 25W X 25L



MELBOURNE CINDERS

PR: 100W X 100L
PTS: 25W X 50L



MELBOURNE GRIS

PR: 100W X 100L
PTS: 25W X 50L



MELBOURNE NOIR

PR: 100W X 100L
PTS: 25W X 50L



ROCK BLACK SILVER

PR: 100W X 100L
PTS: NONE



**ZARAGOZA DARK
GREY**

PR: 100W X 100L
PTS: 17.5W X 17.5L / 45 DEG




robert malcolm

passionate about quality for over 140 years

WWW.ROBERTMALCOLM.CO.NZ

Residential Vinyl Status

Specifications:

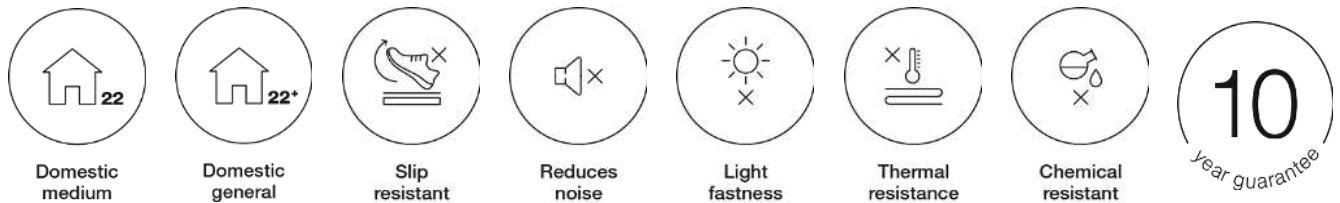


	260 Quality
European classification EN ISO 10874 -	22 / 22+
Total thickness -	2.60 mm
Wear layer -	0.22 mm
Total weight -	1475 g/m ²
Width -	2 m & 3 m
Slip resistance DIN 51130 -	R9
Inflammability -	Cfl-S1
Critical radiant flux ISO 9239.1:2010 -	6.90 KW/m ²
Acoustical insulation EN ISI 717-2 -	20 dB
Light fastness ISO 105-B02 -	≥ 6
Underfloor heating -	Suitable (max 27°C)
Thermal resistance ISO 10456 -	0.04 m ² /kW
Resistance to household chemicals -	OK
Residual indentation EN ISO 24343-1	≤ 0.35 mm
Dimensional stability EN ISO 23999 -	≤ 0.15
Formaldehyde group EN 717-1 -	E1
Total VOC emissions EN 16516 -	Gold
Warranty (year) -	10 years (Residential use)

- RUBBER MIGRATION: This is a condition that can cause vinyl to discolour. Migration occurs when latex or rubber products such as shoes, rubber backed mats or rubber soled slippers come into contact with vinyl over a period of time. This is not a manufacturing fault and therefore is not covered under our warranties.
- Warranties are extended to the original purchaser of the product only and are not transferable.

Please contact us on 03 366 9839 to request any samples or other product details.

international
flooring solutions

p 03 366 9839 e office@robertmalcolm.co.nz
10 Establishment Drive, Christchurch 8042, New Zealand
robertmalcolm.co.nz

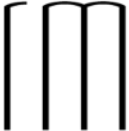
robert malcolm

